

Version: 3.4.0 Date: July. 2005

New Feature:

- 1.) 2 driver packages for Windows 2000/XP. One is version 3.4.0 and the other one is WHQL certificated driver version 4.0.2
- 2.) USB device can be plugged before driver package installation. Setup program will update the USB driver automatically in Windows 2000/XP.
- 3.) iMac driver (version 1.08) support
 - a.) Mouse Mode
 - b.) Constant Touch
 - c.) Auto Right button
- 4.) WinCE driver (version 2.09) include MFC Lib.
- 5.) DOS driver(version 6.0.7) support Constant Touch

Bug Fixed:

- 1.) 25 points calibration cause touch malfunction in Windows OS.
- 2.) Setup program can not always install PS2 driver successfully in Windows 2000/XP
- 3.) Data lost in USB high report rate model of controller in Windows 98/ME

Known Problem:

- 1.) Add/Remove PS2 driver in version 3.x for Windows 2000/XP may cause page fault.

Workaround: Use driver version 4.0.2 instead of 3.x

Version: 3.2.4 Date: February. 2005

Bug Fixed:

- 1.) Fix the bug that the auto-right button timer not precise for capacitive USB and the new edition of 5W USB controller in Windows OS.
- 2.) Fix the bug that the percentage of execution not correct during installation in Windows OS.

Version: 3.2.3 Date: July. 2004

Bug Fixed:

- 1.) Fix the bug that the utility of Touch Tray can not post Right Click after changing right button status in Microsoft Office.

Version: 3.2.2 Date: June. 2004

Bug Fixed:

- 1.) Fix the bug that the utility maybe hanged after monitor mapping in Windows OS.
- 2.) Fix the bug that the utility always show “EEPROM fail” after calibration for 8W USB and capacitive USB controller in Windows OS.

Version: 3.2.1 Date: May. 2004

New Feature:

- 1.) Support “constant touch” for Windows 9X/NT4/ME/2000/XP.

Driver does not report mouse movement event for constant touch when “constant touch” function was activated.

- 2.) Support Auto-Right button. For Windows 9X/NT4/ME/2000/XP.

Driver will report a “right click” mouse event after lift-up from a constant touch if the “Auto-Right button” function was enabled.

- 3.) Enable/disable the pop-up one point calibration utility.

Touchkit utility allows user to enable/disable the pop-up one point calibration utility when the display was rotated by 90 degrees.

Bug Fix:

- 1.) Fix the bug that the system will be hanged during driver installation when the system has built-in software modem which creates virtual COM port in Windows OS.
- 2.) Fix the bug that Touchkit utility reports exception error on some motherboards which has many on board COM ports share same IRQ in Windows 2000/XP.
- 3.) Fix the bug that touch accuracy lost when multi-monitor function enabled and the secondary monitors are located at upper or left side of the primary monitor in Windows OS.